

**Input Files**

z0650d\_for\_S66.cf  
 SCLKSCET.00144  
 091005AP\_LT\_09248\_17265.TXT  
 CAS\_10001\_17182.VP  
 091005AP\_OP\_09248\_17265.TXT  
 S66\_SIP\_PORT1\_GEOEPOCHS\_100728.sasf  
 S66\_SIP\_PORT3\_RIDEREPOCHS\_101029.sasf  
 SP\_S66\_SIP\_PORT3\_DATAPOL\_101026\_r1.sasf  
 SP\_S66\_SIP\_PORT2\_UG2\_PDT\_101001.sasf  
 ULO\_S66\_SIP\_PORT3\_ATT\_101025.sasf  
 ULO\_S66\_SIP\_PORT2\_SFOS\_100907.sasf  
 CAPS\_S66\_SIP\_PORT3\_101028.sasf  
 CDA\_S66\_SIP\_PORT1\_100830.sasf  
 CIRS\_S66\_SIP\_PORT3\_101028.sasf  
 INMS\_S66\_SIP\_PORT1\_100830.sasf  
 ISS\_S66\_SIP\_PORT3\_UG\_101029.sasf  
 MAG\_S66\_SIP\_PORT3\_101028.sasf  
 MIMI\_S66\_SIP\_PORT3\_101027.sasf  
 NAV\_S66\_SIP\_PORT2\_UG1\_100927.sasf  
 RADAR\_S66\_SIP\_PORT2\_UG1\_100928.sasf  
 RPWS\_S66\_SOP\_PORT3\_101028.sasf  
 RSS\_S66\_SIP\_PORT2\_100914.sasf  
 UVIS\_S66\_SIP\_PORT3\_101028.sasf  
 VIMS\_S66\_SIP\_PORT3\_101028.sasf  
 vimsiops\_S66\_SIP\_PORT1\_100830.sasf  
 AACS\_S66\_SIP\_PORT3\_101028.sasf  
 sconote\_S66.sasf  
 CDS\_S66\_SIP\_PORT2\_100909.sasf  
 cds\_duct\_S66\_SIP\_PORT2\_100915\_in.sasf  
 OPMODE\_S66\_SIP\_PORT1\_100830.sasf

**This Merge Has No Files From**

ISSIOPS  
 SI

**IVD Files**

(none)

**SPAM**

ERROR NUMBER	RESPONSIBLE TEAM	TIME	REQUEST	PROBLEM	PROPOSED SOLUTION
<b>TIMING ERRORS</b>					
SP_Timing_Errors_9	SCO	2011-066T02:32:15	ENGR_146SC_KPTYBIAS066_PRIME	Out of place: ENGR in a(n) SP window.	Change ENGR activity to PRIME
SP_Timing_Errors_10	SCO	2011-066T02:58:49	ENGR_146SC_KPTYBIAS066_PRIME	Out of place: ENGR in a(n) SP window.	Change ENGR activity to PRIME
<b>COMMANDS EXPANDED OUTSIDE OF SEQUENCE</b>					
SP_CMDOutside_1	SCO	2011-017T02:27:58.611	ENGR_PBKDELAY001_DUCT	Command occurs before the start of the sequence	Double check your timing
<b>TARGET OPTION LABEL ERRORS</b>					
SP_Label_Error_1	SCO	2011-021T11:15:23.000	ENGR_144SC_YBIASCAL001_AACS	No validation of AACS label in BIAS activity.	Investigation Needed
SP_Label_Error_2	SCO	2011-021T11:52:13.000	ENGR_144SC_YBIASCAL001_AACS	No validation of AACS label in BIAS activity.	Investigation Needed
SP_Label_Error_3	SCO	2011-021T13:30:10.000	ENGR_144SC_YBIASCAL002_AACS	No validation of AACS label in BIAS activity.	Investigation Needed
SP_Label_Error_4	SCO	2011-021T14:07:00.000	ENGR_144SC_YBIASCAL002_AACS	No validation of AACS label in BIAS activity.	Investigation Needed
SP_Label_Error_5	SCO	2011-066T02:58:44.764	ENGR_146SC_KPTYBIAS066_PRIME	No validation of AACS label in BIAS activity.	Investigation Needed
<b>SEQGEN Violations Summary</b>					
sameSecondCommandConflict-22	SCO	2011-030T05:16:10	ENGR_144SC_KPTYBIAS030_PRIME	7RWA_RATE	Investigation needed.
sameSecondCommandConflict-93	SCO	2011-066T02:46:59	ENGR_146SC_KPTYBIAS066_PRIME	7RWA_RATE	Investigation needed.
<b>SPASS//SASF COMPARE</b>					
CIMS_SPASS_SASF_0844	UVIS	2011-053T10:11:00	UVIS_145SA_EUVFUV002_PRIME	SASF does not match the SPASS: Z Offset -53.881 (SASF) <> 0.0 (0.0 deg) (SPASS). Offset tolerance applied was 2.0.	Instrument Team to verify intent of the SPASS
CIMS_SPASS_SASF_0850	ENGR	2011-066T02:32:00	ENGR_146SC_KPTYBIAS066_PRIME	There are pointing commands inside of this SASF Request which does not match a CIMS Prime Request. SASF Request start time is 2011-066T02:32:00	Check your CIMS and SASF request names